

Date: Wednesday, 29/04/2009 10:12:45 AM
 User: Julie Dawson

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : 350 SKIDTUBE ASSEMBLY RH
Job Number : 47578	
Estimate Number : 10268	
P.O. Number :	Part Number : D350636014
This Issue : 29/04/2009 S.O. No. :	Drawing Number : D2750 REV F
Prsht Rev. : NC	Project Number : N/A
First Issue : / / Type : SKIDTUBES	Drawing Revision : F
Previous Run : 47404	Material :
Written By :	Due Date : 10/05/2009 Qty: 1 Um: Each
Checked & Approved By : <u>JLD 09 04 29</u>	
Comment :	
Est Rev:H 02.09.25 Rearranged procedure steps KJ	
Est Rev:I 05.12.08 Rearranged procedure steps EC	
Est Rev:J 06.03.30 Per rev. D EC	
Est Rev:L 07-07-28 Added SS Wearplates(Rev E) JLM	
Verified By:EC	
Est Rev:M 08-09-23 revF as per dwg DD verified by:ec	
Est Rev:O 09-02-06 apply antiseize on AN8C21A bolts as per PAR09-010 DD verified by:EC	

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



for JLD 09/05/11

**Comment:** DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-014 CHG 004

8 09/05/11

2.0	D26003BENT	Extrusion Bent
-----	------------	----------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2600-3-Bent

Extrusion (Bent)

*B47133**D**11 9-5-4*

3.0	D2744	Cap
-----	-------	-----

**Comment:** Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch:

*B44892**11 9-5-4*

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------

**Comment:** LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

11 9-5-4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 47578

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

2-Drill pilot holes as per Dwg D2750 sheet 7 (D2750-4 details). Drill using drill Jig DT8150 & DT8864 .

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8864 and cut as per dwg D2750.

4-Drill pilot holes for blade fitting bolt using DT8983. Open to 0.500".

5- locate DT8929 off of blade fitting holes and drill pilot holes for blade fitting.

6-Open up holes for section BE-BE to 0.375 (2 holes per side) and blade fitting location holes to 0.500" (total of 4 holes per side) as per dwg D2750. Open holes for ground handling and detail A-B to 0.500" (8 holes per side)

7-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 and open to 0.297"

8-Open up holes of Detail A-A to 0.297" (total of 2 holes per side)

9-Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004
A/R Aluminum Rod *M110972 BE 09/05/04*

10-Grind welds flush as per Dwg D2750

11- scribe batch #.

M 9-5-4

5.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 09/05/04

Q

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/05/04

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

M 09-05-04

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

M 9-5-5

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 47578

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Web

Batch:

B 47707

④

M

9-5-5

10.0

D34901

Cross Bolt Spacer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch:

B 47118

④

M 9-5-6

11.0

D34905

Cross Bolt Spacer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch:

B 46490

④

M 9-5-6

12.0

D2743

Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Crossbolt Spacer

Batch:

B 45555

④

M 9-5-6

13.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open up holes section BE-BE 0.500" (4 per side) as per dwg D2750

2-Open holes section BC-BC 0.3125" (4 per side)

3-Open up holes of Detail AB and ground handling to 0.625" (total of 8 holes per side) as per dwg D2750.

4-Chamfer holes of section BE-BE, BC-BC, AB and ground handling (welding instructions on sheet 11)

5-Deburr and blow out all chips from inside of tube. Prepare tube for welding, remove alodine as required.

6-Bond web D2739 in place as per QSI 015

A/R

Sikaflex-291

batch:

M 111031

exp. date:

12-1-1

7- Weld spacers D3490-1, D3490-5 and D2743 as per dwg D2750 & QSI004

M
9-5-5

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 10:12:46 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 47578

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

(welding instructions on sheet 11)

A/R

Aluminum Rod

batch:

M110972 BE 09/05/06

8-Grind welds flush as per Dwg D2750

9-Spot face ground handling holes (total of 4 places per side) as per dwg D2750

10-Deburr holes

fm 09-05-06 (C)

14.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 09/05/08 (C)

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/05/08 (C)

16.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

AL 09-05-11 (C)

17.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

START TIME:

12:50

OVEN TEMPERATURE:

320°

FINISH TIME:

1:20

FL 09/05/11

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

09-05-14 (XV)

19.0

ALS41032225

Insert



Comment: Qty.: 38.0000 Each(s)/Unit Total: 38.0000 Each(s)

Insert

Batch:

M110768-

AL 09-05-14 (XV)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 10:12:46 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 47578

Part Number: D350636014

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

20.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

✓ Install inserts as per dwg D2750

2-assemble o'ring as per dwg D3492 and apply o'ring lube

✓ A/R 55-o'ring lube batch: 11101223

11 09-05-14 SL

21.0	D2745	Bushing
------	-------	---------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Bushing

Batch: 1346695

11

22.0	D37911	Wearplate
------	--------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: 1347536

11

23.0	D37931	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearshoe

Batch: 1347537

11

24.0	D37933	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearshoe

Batch: 1347211

11

25.0	D37941	Gasket
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

Batch: 1347721

11

09-05-15 SL

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 10:12:46 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 47578

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

26.0

D37943

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

Batch: 1347440

JK

27.0

D353525

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1347204

JK

28.0

D353625

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: 1347526

JK

29.0

D35371

Wearpad



Comment: Qty.: 3.0000 Each(s)/Unit Total : 3.0000 Each(s)

WEARPAD

Batch: 1347530

JK

30.0

D36311

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

WASHER

Batch: 1347437

JK

31.0

D3488042

Blade Fitting Assembly, RH



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade Fitting, RH

Batch: 1344531

JK

32.0

NAS1611010

O-RING



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

O-RING

NAS1611-010 batch: _____

(or MS28775-010) batch: _____

04-05-14 JK

PTO F2

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
09-05-14	32-0	Replace "o" rings NAS 1611-010 with 02594-3 1329908	JD	09-05-14	x8		S 09/05/14

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 10:12:46 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 47578

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

33.0

NAS1611005

O-RING



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

O-RING

batch: M1106609

ju

34.0

D34921

Plug



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Plug

batch: B47472

ju

35.0

D34925

Plug



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

* Plug

batch: B43452

ju

36.0

AN3C5A

Bolt



Comment: Qty.: 34.0000 Each(s)/Unit Total : 34.0000 Each(s)

Bolt

Batch: M111707

ju

37.0

AN3C6A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M110372

ju

38.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M110865

M

39.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

BOLT

Batch: M110105

M

09-05-15 (XU)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 10:12:46 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 47578

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

40.0

AN960C10L

washer



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

washer

Batch: M111608

M

41.0

AN960C816L

WASHER



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WASHER

Batch: M110372

MP

42.0

MS210436

NUT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

NUT

Batch: M110584

ell

43.0

MS21083C8

NUT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

NUT

Batch: M1111637

lu

44.0

NAS1515H3L

WASHER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

WASHER

Batch: M110806

lu

45.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

✓ 1-Assemble tube hardware as per dwg D2750

sikaflex batch: M111081 10/20

✓ 2-Inspect For Foreign Objects

X 3-Spray inside of tube with "LPS-3" batch: NA

4-Install blade fitting D3488-041, wearshoe

SIKA FLEX 241

BATCH: M111081

gl

09-05-15

(X)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 47578

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

EXP DATE: 10/20

5-assemble o'ring to plug as per dwg D3492 and apply o'ring lube

2 A/R 55-o'ring lube batch: M101223

(6-Coat all exposed fasteners with "LPS Procyon" batch: M104251

9/09-05-15 (X)

46.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/05/15 (X)

47.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

48.0

D2741

Blade, 350 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Blade

Batch: D45320

9/5/19

SP

49.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M111424

9/5/19

SP

50.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Nut

Batch: M111637

9/5/19

SP

51.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: M110342

****apply antiseize prior to packaging****

Batch: M110658

9/5/19

SP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 10:12:46 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 47578

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

52.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M103964

9/5/19

SP

53.0

D34931

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: 44902

9/5/19

SP

54.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

*****ensure antiseize is on AN8C21A bolts*****

509/05/19

SP

55.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-014

Rev 5 9/5/20

SP

56.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

09/05/2019

Job Completion



MF 09-05-20

B47578

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

8

7

6

5

4

3

2

1

QTY -041	QTY -042	QTY -043	QTY -044	PART NUMBER	DESCRIPTION
X				D2750-041	350 SKIDTUBE ASSEMBLY, LH
	X			D2750-042	350 SKIDTUBE ASSEMBLY, RH
		X		D2750-043	350 SKIDTUBE ASSEMBLY, LH
			X	D2750-044	350 SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
1	1	1	1	D3535-25	WEARSHOE
1	1	1	1	D3536-25	GASKET
3	3	3	3	D3537-1	WEARPAD
8	8	8	8	D3631-1	WASHER
1	1	1	1	D3791-1	WEARPLATE
1	1	1	1	D3793-1	WEARSHOE
1	1	1	1	D3793-3	WEARSHOE
1	1	1	1	D3794-1	GASKET
1	1	1	1	D3794-3	GASKET
38	38	38	38	ALS4-1032-225	INSERT (OR ALS7-1032-225, AKS4-1032-225, AELS-1032-225)
34	34	34	34	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN6C44A	BOLT
1	1	1	1	AN8C35A	BOLT
38	38	38	38	AN960C10L	WASHER
1	1	1	1	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER


GENERAL NOTES:

- MATERIAL: MAKE D2750-1/-2/-3/-4 FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
- FINISH:
ACID ETCH, ALONDE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
- TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED
- BREAK SHARP EDGES: N/A
- IDENTIFICATION: N/A
- WEIGHT: D2750-041/-042/-043/-044 = 26.5 LBS
- WELD PER DART QSI 004
- INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED. DRILL 'F' SIZE HOLES ($\phi 0.297$) FOR WEARSHOE INSERTS
- FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 38 KSI
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS.
COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF
POWDER COATING WITH MEK DEGREASER.
SPACER AND PLUG INSTALLED SAME AS SECTION AJ-AJ EXCEPT HORIZONTAL
SPACER AND PLUG INSTALLED SAME AS SECTION AP-AP EXCEPT HORIZONTAL

RELEASED
68 09 22 14

F	INCORPORATE DSI 8413; QTY (3) D3537-1 WAS QTY (5) (ZN C8-1); D3791-1/-3 REPLACES D3535-13/-35 (ZN C8-1); D3794-1/-3 REPLACES D3536-13/-35 (ZN B8-1); ADD D3791-1 (ZN C8-1); WEARSHOE HOLES UNDER FWD/AFT SADDLE REMOVED (8 PL). WEARSHOE HARDWARE QTY UPDATED (ZN B8-1); D3488-041/-042 HARDWARE UPDATED (ZN C1-8, 9, 10, 11); ADD NOTE 12 AND 13 (ZN A6-1); REASON: REF. NCR 08-043	PH	08.07.16
E	CHANGE TO STAINLESS STEEL WEARPLATES; ADD RUBBER GASKETS; CHANGE INSERTS; ADD D3631-1; REMOVE QTY (38) NAS1515H3L; REMOVE QTY (10) NAS1515H8L; REMOVE D2741, QTY (2) AN960C816; REMOVE QTY (2) MS21083C8	CB	07.05.17
D	ADD HOLES AND SPACERS FOR APICAL FLOATS; INCORPORATE DEO 9133/9157	PH	06.01.05
C	ADD D2750-3/D2750-4; INCORPORATE D2738 AND D2740	CP	98.11.18
B	CHANGE MS24694-S293 TO AN8-16A	CP	98.09.01
A	NEW ISSUE	DS	98.04.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DART AEROSPACE USA, INC.		
DRAWN	PORT HADLOCK, WA		
CHECKED	DRAWING NO.	REV. F	
MFG. APPR.	D2750	SHEET 1 OF 11	
APPROVED	TITLE	SCALE	
DE APPR.	350 SKIDTUBE ASSEMBLY	NTS	
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIES OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

NO. 41518
WORK ORDER
WITHOUT NOTICE
TO AMENDMENT
ENGINEERING
RETURN TO
SHOP COPY
CONTROLLED COPY

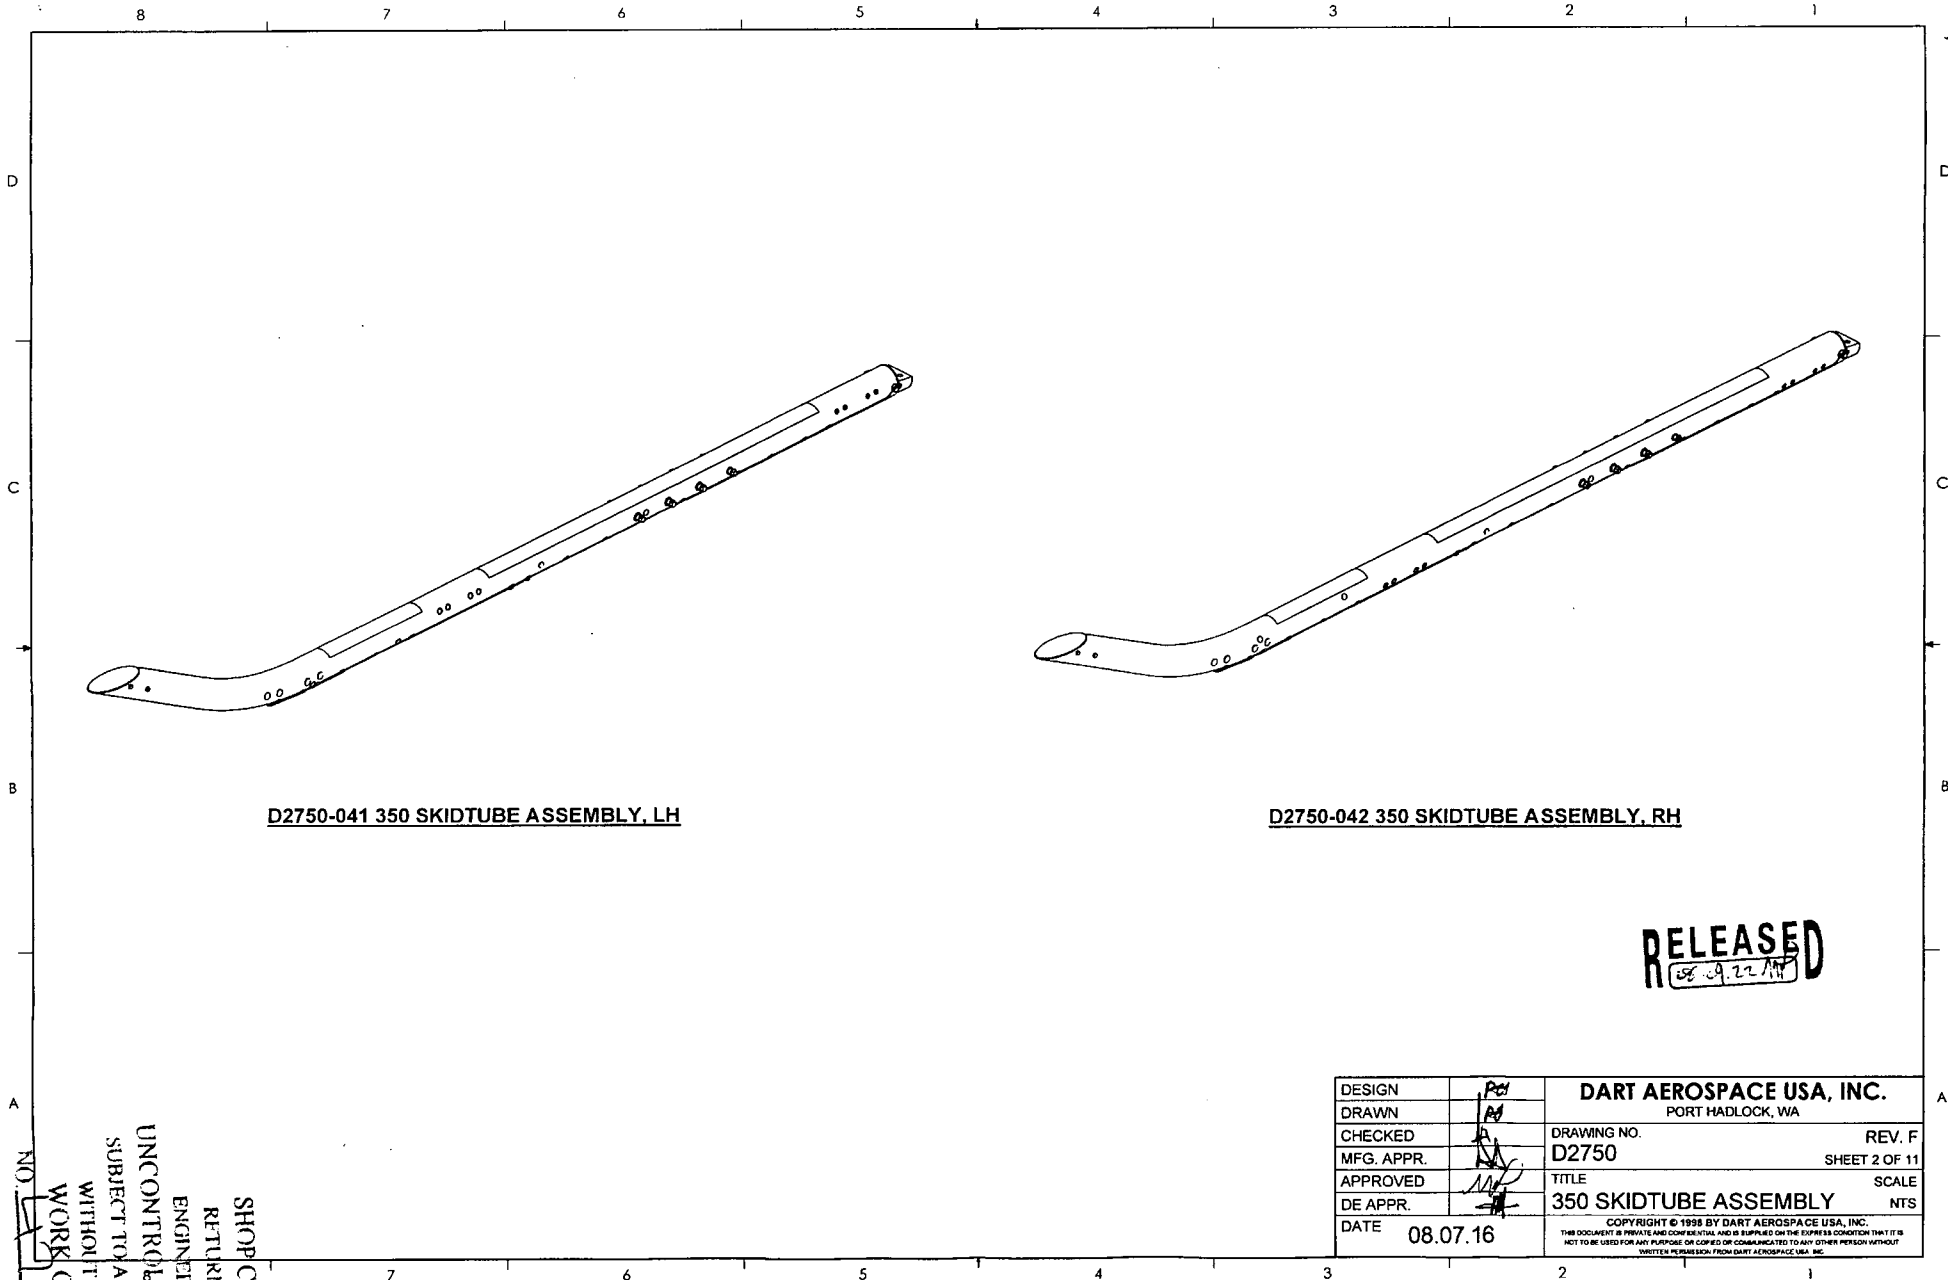

D2750-041 350 SKIDTUBE ASSEMBLY, LH

D2750-042 350 SKIDTUBE ASSEMBLY, RH

RELEASED
 08-09-22-11

NO. 14578
 WORK ORDER
 WITHOUT NOTICE
 SUBJECT TO AMENDMENT
 UNCONTROLLED COPY
 ENGINEERING
 RETURN TO
 SHOP COPY


DESIGN	PC	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
DRAWN	AD		
CHECKED	A	DRAWING NO. D2750	REV. F
MFG. APPR.	ME	SHEET 2 OF 11	
APPROVED	ME	TITLE	SCALE
DE APPR.	ME	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

8 7 6 5 4 3 2 1


D

C

B

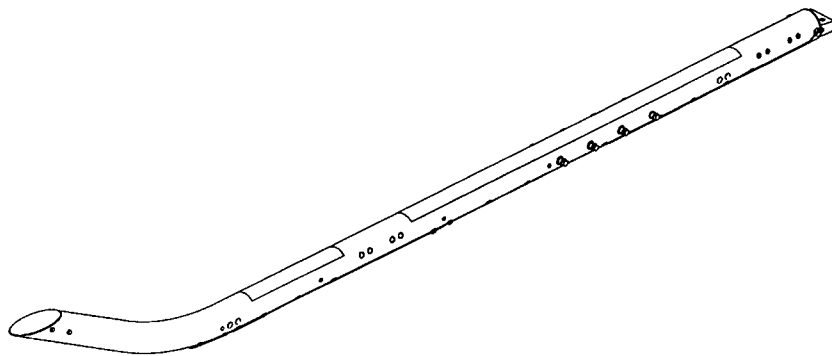

D2750-043 350 SKIDTUBE ASSEMBLY, LH

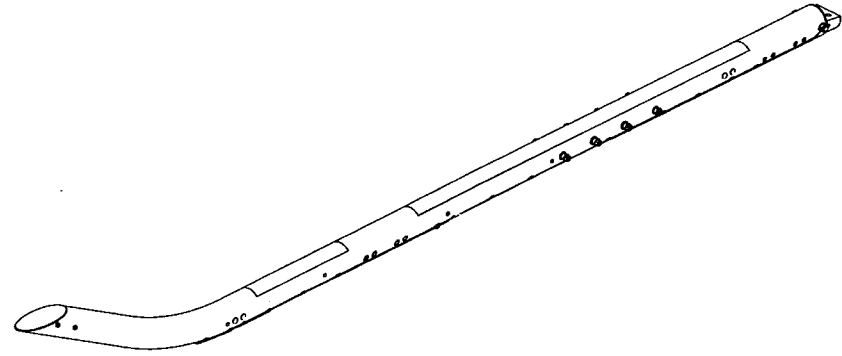


D2750-044 350 SKIDTUBE ASSEMBLY, RH

RELEASED
68-09 22 1/2


DESIGN	PD	DART AEROSPACE USA, INC.	
DRAWN	PD	PORT HADLOCK, WA	
CHECKED	NA	DRAWING NO.	REV. F
MFG. APPR.	NA	D2750	SHEET 3 OF 11
APPROVED	NA	TITLE	SCALE
DE APPR.	NA	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1988 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

WORK ORDER
NO. 47578
SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE


7 6 5 4 3 2 1

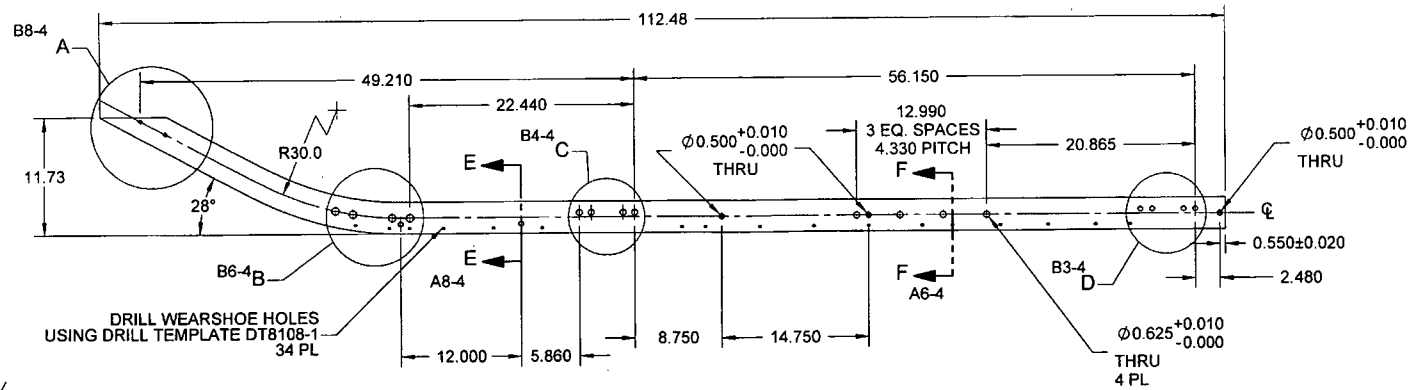


D2750-1 LH SKIDTUBE

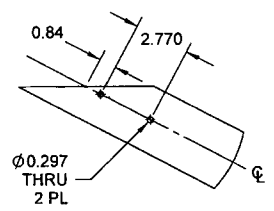


DETAIL A
SCALE 2X

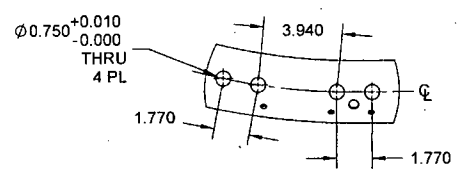


DETAIL B
SCALE 2X

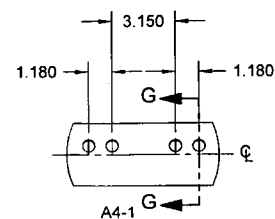


DETAIL C
SCALE 2X

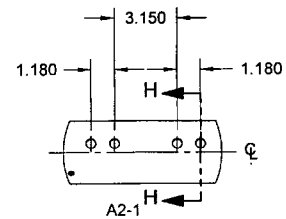


DETAIL D
SCALE 2X

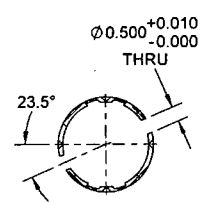


SECTION E-E
SCALE 3X, 2 PL

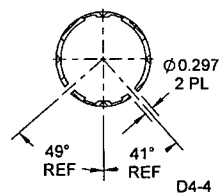

SECTION F-F
SCALE 3X, 17 PL

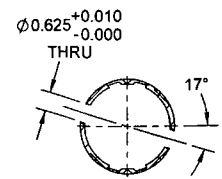

SECTION G-G
SCALE 3X, 4 PL

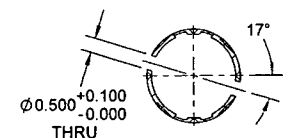


SECTION H-H
SCALE 3X, 4 PL

RELEASED


DESIGN		DART AEROSPACE USA, INC.
DRAWN		PORT HADLOCK, WA
CHECKED		DRAWING NO. D2750
MFG. APPR.		REV. F
APPROVED		SHEET 4 OF 11
DE APPR.		TITLE 350 SKIDTUBE ASSEMBLY
DATE	08.07.16	SCALE NTS

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


WORK ORDER NO. 47578
SHOR COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

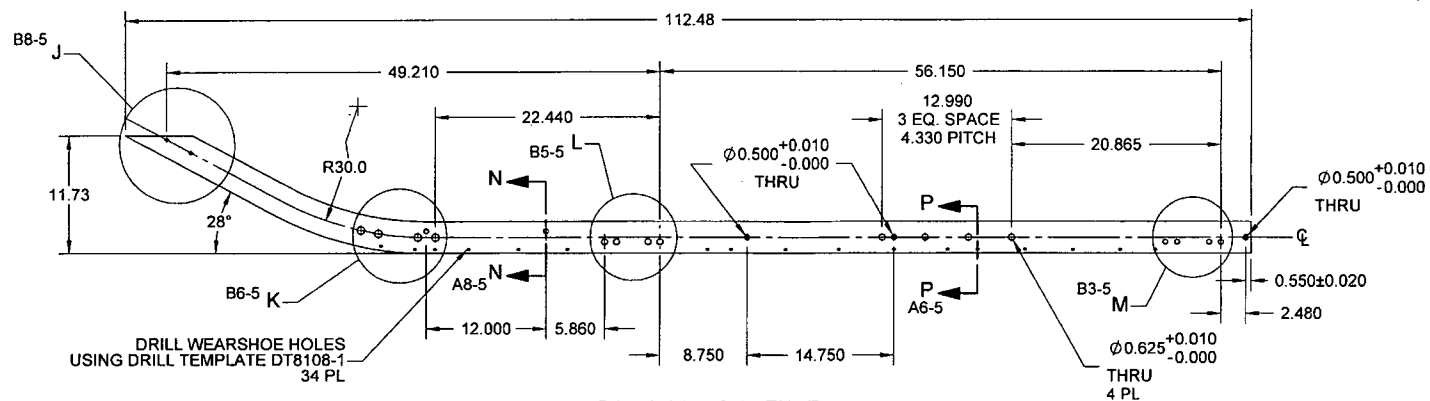


D2750-2 RH SKIDTUBE

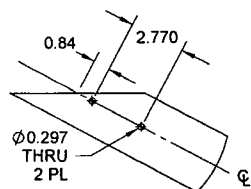


DETAIL J
SCALE 2X

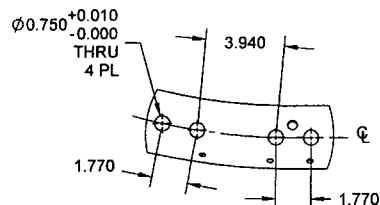


DETAIL K
SCALE 2X

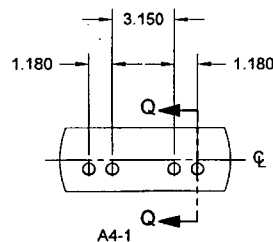


DETAIL L
SCALE 2X

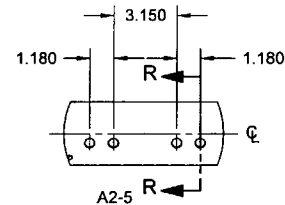


DETAIL M
SCALE 2X

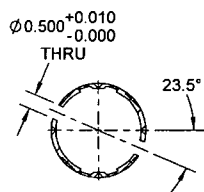


SECTION N-N
SCALE 3X, 2 PL

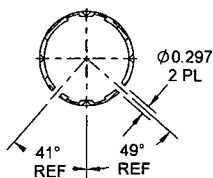

SECTION P-P
SCALE 3X, 17 PL

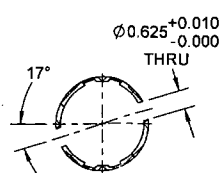

SECTION Q-Q
SCALE 3X, 4 PL

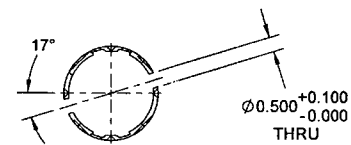


SECTION R-R
SCALE 3X, 4 PL

RELEASED


DESIGN	REV	DART AEROSPACE USA, INC.	
DRAWN	REV	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 5 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

NO 47518
WORK ORDER
WITHOUT NOTICE
SHOP COPY
RETURN TO
ENGINEERING
ON FROLLED COPY
SUBJECT TO AMENDMENT


8 7 6 5 4 3 2 1

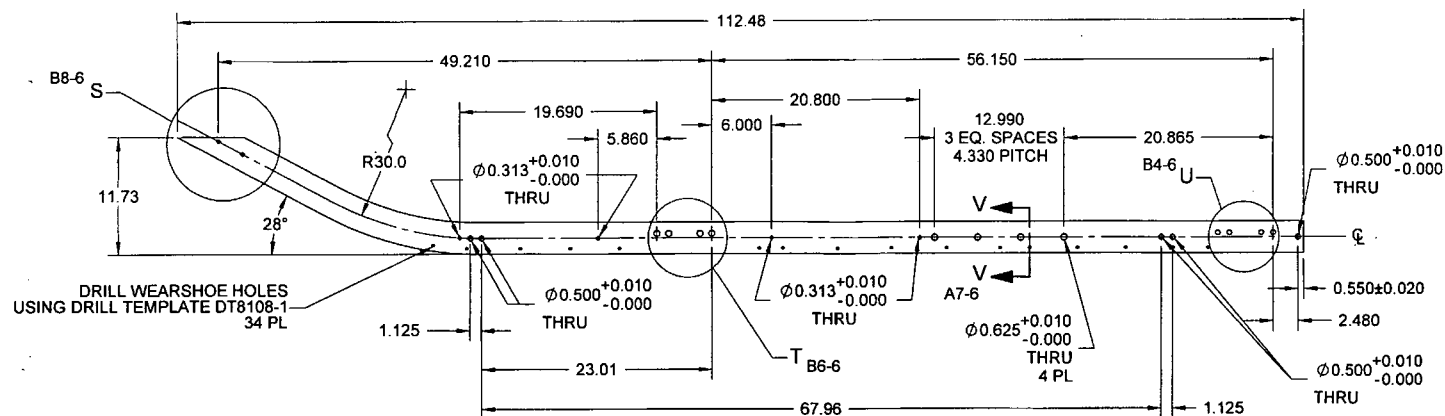


D2750-3 LH SKIDTUBE

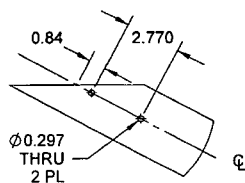


DETAIL S
SCALE 2X

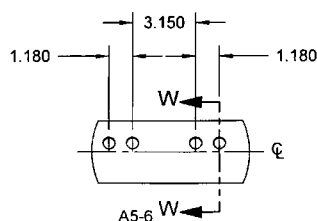


DETAIL T
SCALE 2X

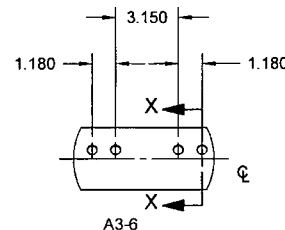


DETAIL U
SCALE 2X

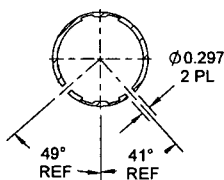

SECTION V-V
SCALE 3X, 17 PL

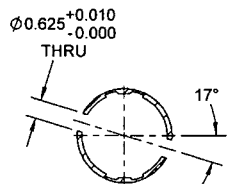

SECTION W-W
SCALE 3X, 4 PL

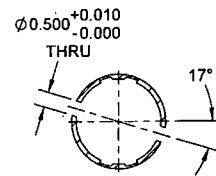


SECTION X-X
SCALE 3X, 4 PL


RELEASED

DESIGN		DART AEROSPACE USA, INC.	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO. D2750	REV. F
MFG. APPR.			SHEET 6 OF 11
APPROVED		TITLE 350 SKIDTUBE ASSEMBLY	SCALE
DE APPR.			NTS
DATE	08.07.16	<small>COPYRIGHT © 1988 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


WORK ORDER
NO. 49578
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
ENGINEERING
RETURN TO
P/COPY

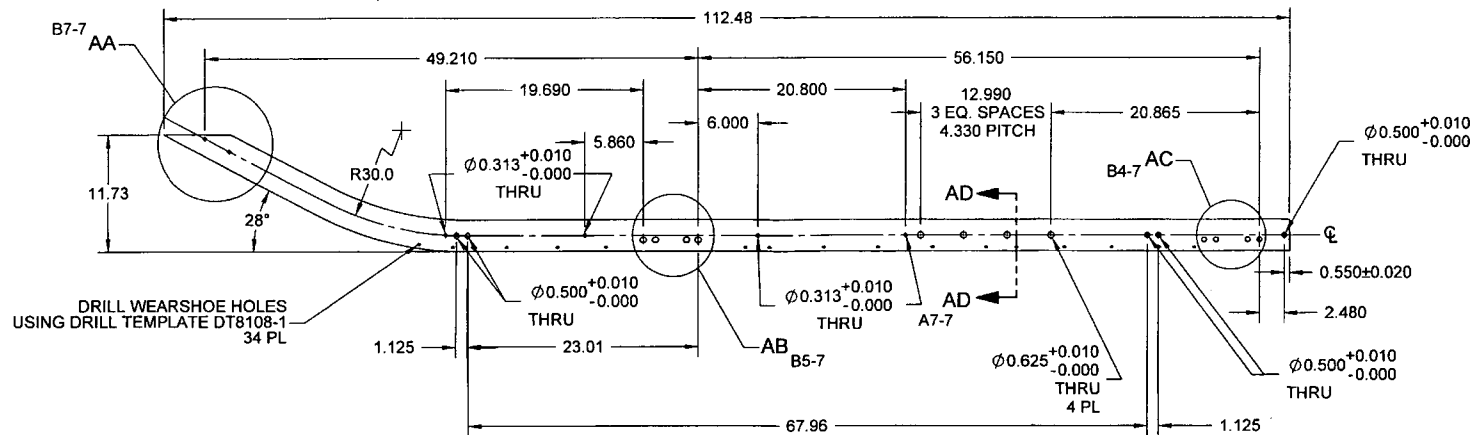


D2750-4 RH SKIDTUBE

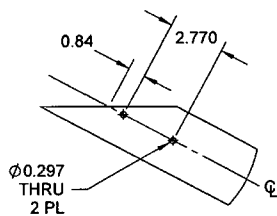


DETAIL AA
SCALE 2X

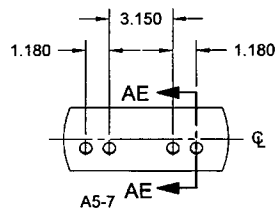


DETAIL AB
SCALE 2X

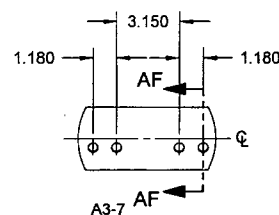


DETAIL AC
SCALE 2X

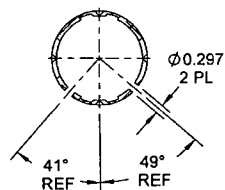

SECTION AD-AD
SCALE 3X, 17 PL

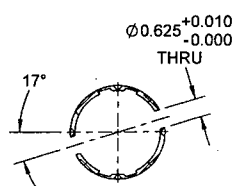

SECTION AE-AE
SCALE 3X, 4 PL

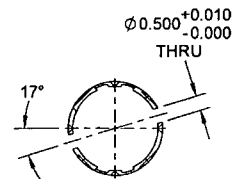


SECTION AF-AF
SCALE 3X, 4 PL

RELEASED

DESIGN		DART AEROSPACE USA, INC.	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO. D2750	REV. F
MFG. APPR.		SHEET 7 OF 11	
APPROVED		TITLE 350 SKIDTUBE ASSEMBLY	SCALE
DE APPR.		NTS	
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
ENGINEERING
RETURN TO
COPY
NO. **47578**

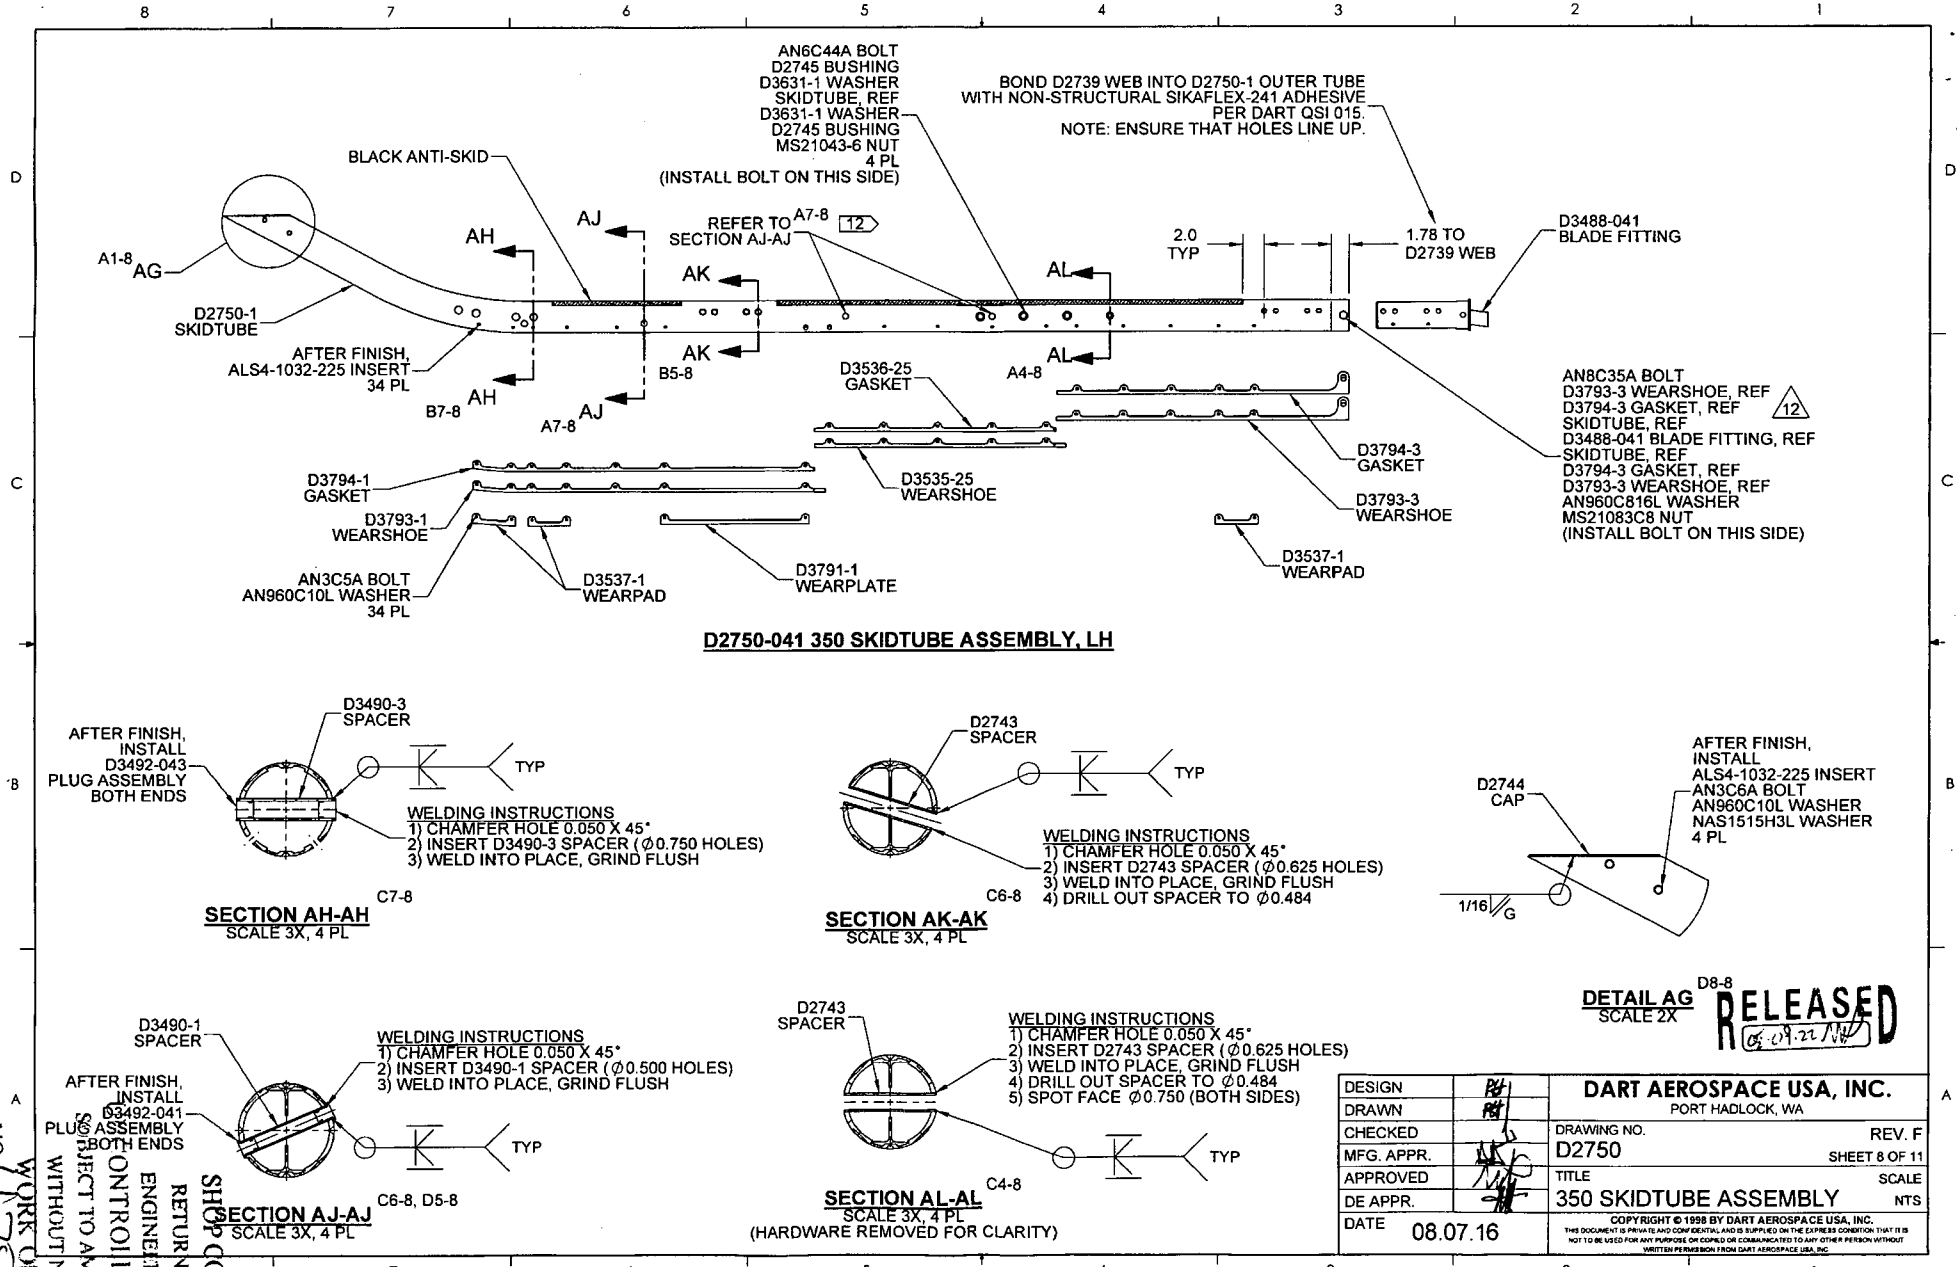


NO. 47528
WORK ORDER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
ENGINEERING
RETURN TO
SHOP COPY
ONTROLLED COPY

DESIGN	PA	DART AEROSPACE USA, INC.	
DRAWN	PA	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 8 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


D8-8
RELEASED
08.07.16

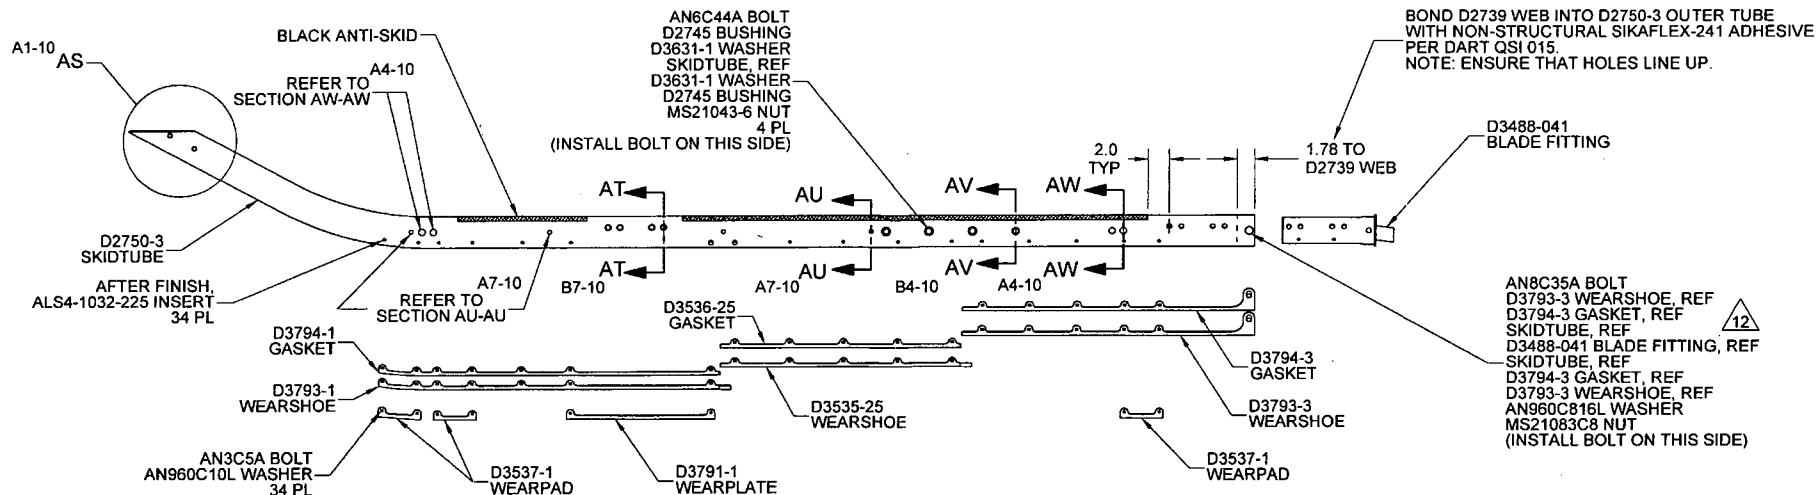


D2750-043 350 SKIDTUBE ASSEMBLY, LH

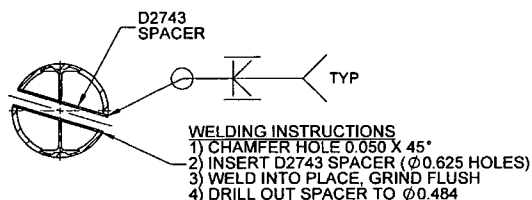


SECTION AT-AT
SCALE 3X, 4 PL

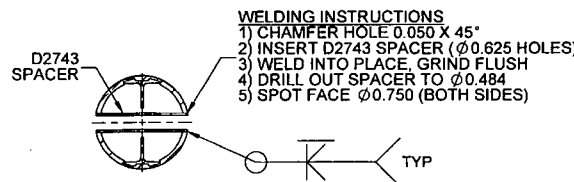


SECTION AV-AV
SCALE 3X, 4 PL
(HARDWARE REMOVED FOR CLARITY)

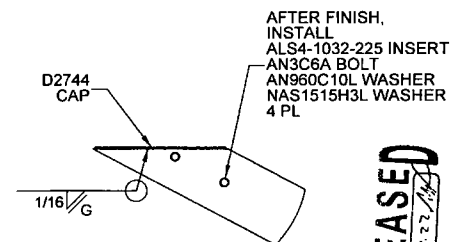

DETAIL AS
SCALE 2X

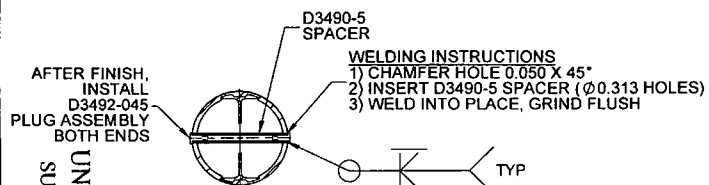

SECTION AU-AU
SCALE 3X, 4 PL

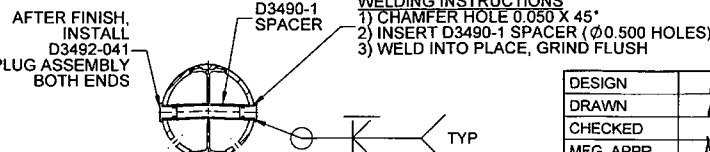


SECTION AW-AW
SCALE 3X, 4 PL

DESIGN		DART AEROSPACE USA, INC.	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO. D2750	REV. F
MFG. APPR.			SHEET 10 OF 11
APPROVED		TITLE 350 SKIDTUBE ASSEMBLY	SCALE
DE APPR.			NTS
DATE	08.07.16	<small>COPYRIGHT © 1996 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

WORK ORDER
NO. 47578
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
RETURN TO
ENGINEERING
FOR COPY






RELEASED
28 JUL 2016

8 7 6 5 4 3 2 1

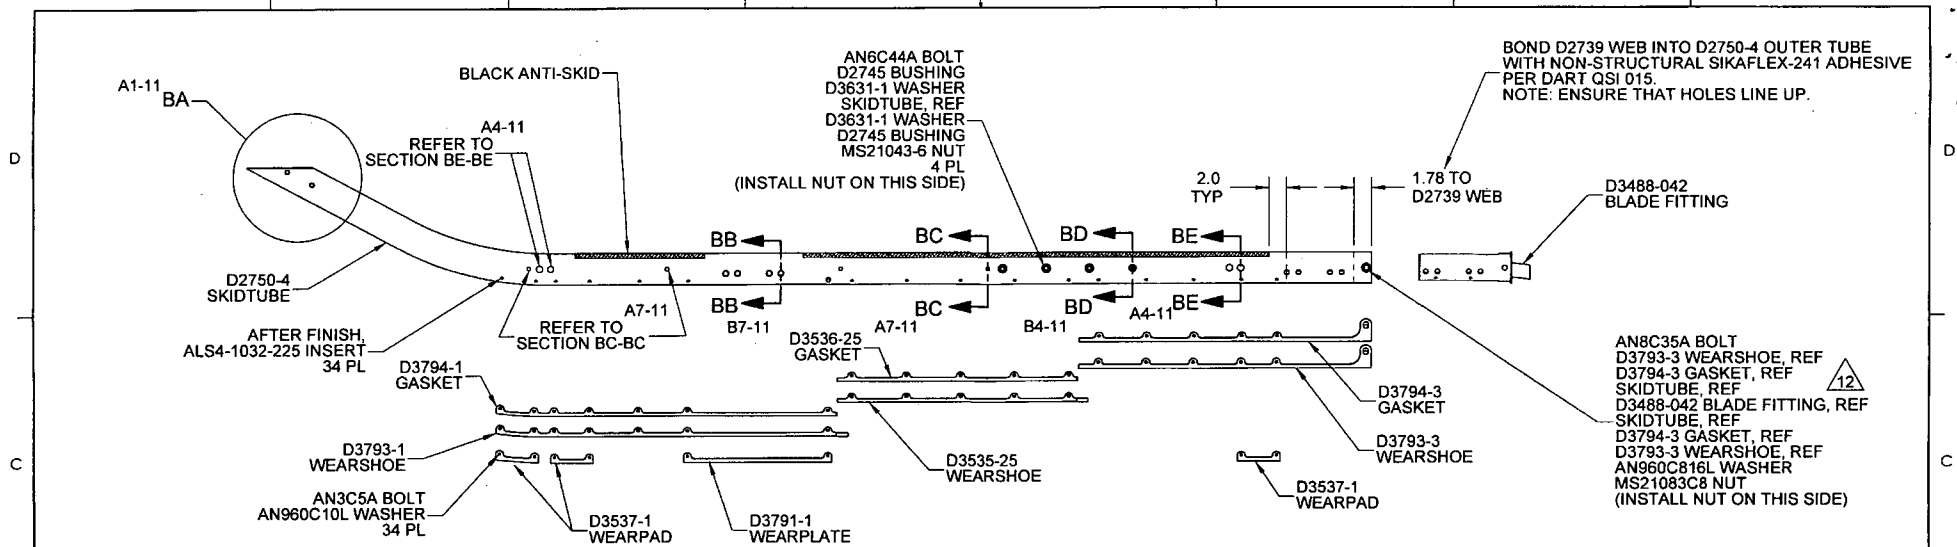

D2750-044 350 SKIDTUBE ASSEMBLY, RH

RELEASED
06-07-22

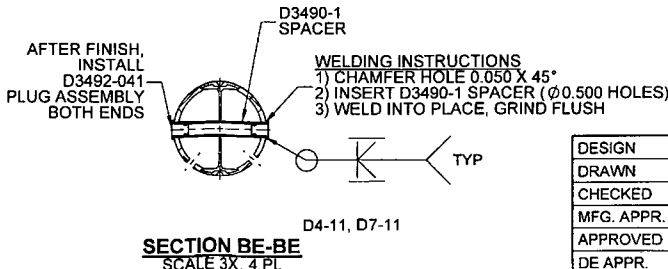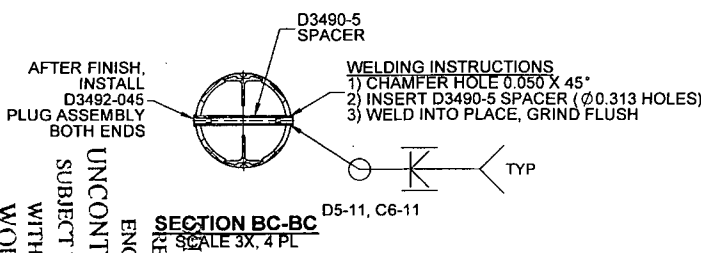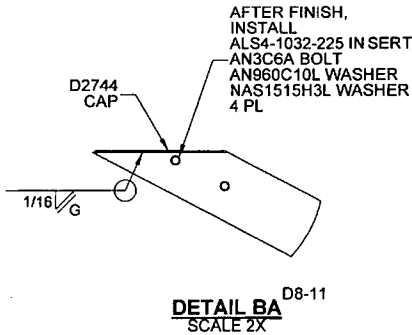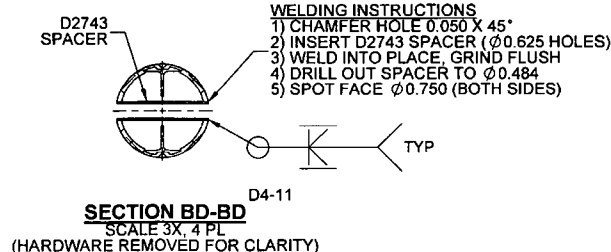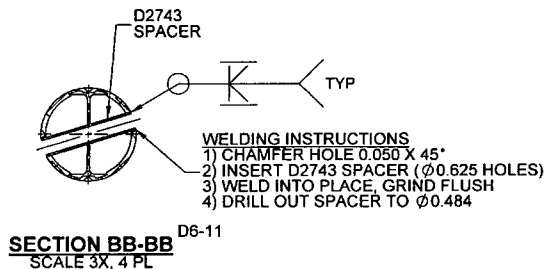


DESIGN		DART AEROSPACE USA, INC.	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO. D2750	REV. F
MFG. APPR.			SHEET 11 OF 11
APPROVED		TITLE 350 SKIDTUBE ASSEMBLY	SCALE
DE APPR.			NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

NO. 71578
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
RETURN TO
ENGINEERING
TOP COPY

D3492-XX PLUG
(SEE TABLE)

NAS1611 PLUG
(SEE TABLE)

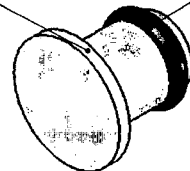

D3492-XXX PLUG PARTS LIST

QTY -041	QTY -043	QTY -045	QTY -047	QTY -049	QTY -051	QTY -053	PART NUMBER	DESCRIPTION
X							D3492-041	PLUG ASSEMBLY
	X						D3492-043	PLUG ASSEMBLY
		X					D3492-045	PLUG ASSEMBLY
			X				D3492-047	PLUG ASSEMBLY
				X			D3492-049	PLUG ASSEMBLY
					X		D3492-051	PLUG ASSEMBLY
						X	D3492-053	PLUG ASSEMBLY
1							D3492-1	PLUG
	1						D3492-3	PLUG
		1					D3492-5	PLUG
			1				D3492-7	PLUG
				1			D3492-9	PLUG
					1		D3492-11	PLUG
						1	D3492-13	PLUG
		1					NAS1611-005	O-RING
			1				NAS1611-007	O-RING
1							NAS1611-010	O-RING
						1	NAS1611-012	O-RING
	1						NAS1611-013	O-RING
					1		NAS1611-015	O-RING
				1			NAS1611-016	O-RING

△ △ △

NOTES:

1) O-RING: POSSIBLE SUPPLIER P/N: NAS1611-XXX OR PARKER 2-XXX

~~UNDER REVIEW~~
02.04.11
OK ASS 08.11.12

DEO ATTACHED

RELEASED
01.11.16

C	ADD -049/-051/-053, CHANGE DRAWING FORMAT	PH	07.10.05
B	ADD -047; UPDATE DIM A FOR -045	PH	06.05.11
A	NEW ISSUE	PH	06.01.04
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	07.10.05		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D3492	REV. C
TITLE PLUG	SHEET 1 OF 2
SCALE 2:1	
COPYRIGHT © 2007 BY DART AEROSPACE LTD. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITH/IT NOTICE
WORK ORDER
NO. 47578



D3492-XX PLUG

D3492-XX PLUG MACHINING DETAILS

P/N	A	B	C	MATERIAL SPEC
D3492-1	0.625	0.394	0.055	M6061T6R0.625
D3492-3	0.750	0.582	0.045	M6061T6R0.750
D3492-5	0.375	0.188	0.045	M6061T6R0.375
D3492-7	0.500	0.270	0.045	M6061T6R0.500
D3492-9	0.938	0.750	0.045	M6061T6R1.000
D3492-11	0.850	0.664	0.045	M6061T6R0.875
D3492-13	0.750	0.520	0.045	M6061T6R0.750

NOTES:

- NOTES:**
1) MATERIAL: ALUMINUM 5052-H32 OR 6061-T6 OR 1100-O PER QQ-A-225/7 (5052) OR QQ-A-225/8 (6061) OR QQ-A-200/8 (6061) OR QQ-A-225/1 (1100) (REF. DART MATERIAL SPEC M6061T6R0.000)
2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 POWDER COAT WHITE GLOSS (4.3.5.1) PER DART QSI 005 4.3
3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
4) UNITS: INCHES UNLESS OTHERWISE NOTED
5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
6) IDENTIFICATION: N/A
7) WEIGHT: N/A

DEO ATTACHED

RELEASE
07.11.16

~~UNDER REVIEW~~

01-04-71

~~DEM BUN DUTCH~~
~~NIVE 3 MALLER~~

3 REB. 12 11.17

15300

OKay

DELETED

27.11.14

DESIGN	<i>Red</i>	DART AEROSPACE LTD	
DRAWN	<i>Red</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. C
MFG. APPR.	<i>[Signature]</i>	D3492	SHEET 2 OF 2
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	PLUG	4:
DATE	07.10.05	COPYRIGHT © 2007 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE LTD.	

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER NO. 4878

DRAWING NO. D3492	TITLE PLUG	REV. C	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D3492-C-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN AJS	CHECKED	MFG. APPR.	APPROVED		DE APPR.		
DATE 08.11.05	DATE 08.11.05	DATE 08.11.05	DATE 08/11/05		DATE 08/11/05		

SHEET 2 MODIFY -13 PLUG AS SHOWN:

IS:

D3492-XX PLUG MACHINING DETAILS

P/N	A	B	C	MATERIAL SPEC
D3492-13	0.750	0.510	0.045	M6061T6R0.750

WAS:

D3492-XX PLUG MACHINING DETAILS

P/N	A	B	C	MATERIAL SPEC
D3492-13	0.750	0.520	0.045	M6061T6R0.750

RELEASED
08/11/10

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER NO. 47578

NO. 197

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barday Elliott
Job number: 47399
Part number: D350 636 012
Description: 350 skid tube
Welding Process: Tig[☒] Mig[]
Base material: Aluminium
Current: AC[] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier P. J. Dault Date of Test Coupon 09-04-27
Welder Barday Elliott Date of Test Coupon 09-04-27

The above named individual is qualified in accordance with AWS D17.1.2001 to weld